

Work Order ID 57531

Thursday, April 08, 2010 8:19:43 AM



Page 1

Item ID: D412-664-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 4/9/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 4/30/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: MF

Date: 10-4-8

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Draw
Number

Draw
Rev.

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr	Revision Nbr
D412-664-243	E

100

0.00



DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PTP D412-664-203 CHG 006

110

0.00



Packaging

Packaging

Memo

0.00

Packaging

120

0.00



BENDING MACHINE - CROSSTUBES

CNC Bend 2

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D412-664-243 using CNC bender program 412-aft and Folio FT010



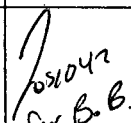




SCRAP

PB

MB 10-04-26

W/O:		WORK ORDER CHANGES						
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D412-664-203 PAR #: _____ Fault Category: X-tube NCR: Yes No DQA: ✓ Date: 10/05/12
 Resolution: Scrap Disposition: Scrap QA: N/C Closed: ✓ Date: 10/05/12

NCR: 57531		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
10/04/26	# 120	tube was in marks / cracks in Bend. E.C. set up up of machine were not adjusted correctly.	 S.B.B.	- tube is scrap - marks over allowed tol. - inform employees to check the set ups before starting	MJB 10-04-26 	S 10/04/26	 S.B.B.	 10/04/26
		Lack of attention.	 10/04/26 QSI 042	Benley	10-5-6		 10/04/26 QSI 042	 10/04/26

NOTE: Date & initial all entries

Work Order ID 57531

Thursday, April 08, 2010 8:19:43 AM



Page 2

Item ID: D412-664-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 4/9/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 4/30/2010 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

130

QC15- Crosstube Dimensional Check

0.00



QC

Memo

0.00

Quality Control

140

Crosstubes

0.00



Crosstubes

Memo

0.00

Crosstubes

1-Drill pilot holes in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551

2-Ream hole to finish size in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-SCRIBE PART # & BATCH #

4-Deburr & Insp for surface damage. Repair damage within limits as per Dwg D412-664-243

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 57531

Thursday, April 08, 2010 8:19:43 AM



Page 3

Item ID: D412-664-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 4/9/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 4/30/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150 HandFXtube Hand Finishing Crosstubes	Crosstubes Chemical Conversion Memo	0.00 0.00							
160 QC Quality Control	QC3- Inspect Part Finish Memo	0.00 0.00							
170 QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00							

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 57531

Thursday, April 08, 2010 8:19:43 AM



Page 4

Item ID: D412-664-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 4/9/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 4/30/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180 	Outsource process - NDT per QSI038 4.1	0.00							
Outsource2	Memo	0.00							
Outsource process - NDT	Liquid Penetrant Inspection as per QSI 038Or Issue P/O: _____ LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order								
190 	Packaging	0.00							
Packaging	Memo	0.00							
Packaging	Inspect for transit damage Ensure copy of NDT results attached to work order.								
200 	QC5- Inspect part completeness to step on W/O	0.00							
QC	Memo	0.00							
Quality Control	Inspect for damage & ensure results are as per Dwg D412-664-203								

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 57531

Thursday, April 08, 2010 8:19:43 AM



Page 5

Item ID: D412-664-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 4/9/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 4/30/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210		0.00							
	SprayPaint								
SprayPaint	Memo	0.00							
Spray Painting	1-Prime inside and outside crosstube as per QSI 005 4.2 2-Paint outside crosstube with White Imron as per QSI 005 4.2 PRIME: Start Time: _____ Fininsh Time: _____ PAINT: Start Time: _____ Finish Time: _____								
220		0.00							
	QC14- Inspect Spray Paint								
QC	Memo	0.00							
Quality Control	Then, Wrap in plastic bag to protect from scratches								

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 57531

Thursday, April 08, 2010 8:19:43 AM



Page 6

Item ID: D412-664-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 4/9/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 4/30/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start



QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

230

0.00



Crosstubes

Crosstubes

Memo

0.00

Crosstubes

Assemble as per Dwg D412-664-203

1- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

2-Install supports with magnobond as per QSI 015 Adhere for for 12 Hrs

A/R 6398 Magnobond Batch: _____
Expiry Date: _____

3-Install clamps as per Dwg D212-664-203 using installaiton jig DT9024 with 0.010 thick brass shims on both chafing sheild (D3189-1). Torque clamps to 80-100 in lb.

240

0.00



QC

QC5- Inspect part completeness to step on W/O

Memo

0.00

Quality Control

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 57531

Thursday, April 08, 2010 8:19:43 AM



Page 7

Item ID: D412-664-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 4/9/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 4/30/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250 	Pick Kit	0.00							
Packaging	Memo	0.00							
Packaging									
260 	QC4- 100% Inspect kits for completeness	0.00							
QC	Memo	0.00							
Quality Control									
270 	Packaging	0.00							
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D412-664-203 *****Ensure tube is not packaged if curing time is less than 12 hrs, see step 27 for application time & date ***** Time & date of packaging: _____ Location: _____								

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 57531

Thursday, April 08, 2010 8:19:43 AM



Page 8

Item ID: D412-664-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 4/9/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 4/30/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

280

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

MF
10-5-10

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Thursday, April 08, 2010 8:19:42 AM

Page 1

Work Order ID: 57531



Parent Item: D412-664-203



Parent Item Name: Crosstube Aft

Start Date: 4/9/2010

Required Date: 4/30/2010

Comments: IPP Rev:E 04.02.16 Reformat; Added D3189-1 K/DS
IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
IPP Rev:G 06.12.08 per ECN 886 EC
IPP Rev:H 07-04-30 As per Rev D JLM

Start Qty: 1.00

Required Qty: 1.00

D412-664-203TRN Manufactured No 110 Each 0.0000 1.0000



B-57345 MB 10-04-26

Crosstube Turning Detail

D2856-600 Manufactured No 230 f 272.2300 1.7600



Abrasion Strip

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST403 272.23

25656 1.25

26650 2.5

36398 32.48

37668 236

D2896-1 Manufactured No 230 Each 23.0000 1.0000



Support

Warehouse Loc Qty Loc Code

Location

Main Warehouse

LG 23

43209 3

47820 20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Thursday, April 08, 2010 8:19:42 AM

Page 2

Work Order ID: 57531



Parent Item: D412-664-203



Parent Item Name: Crosstube Aft

Start Date: 4/9/2010

Required Date: 4/30/2010

Comments: IPP Rev:E 04.02.16 Reformat; Added D3189-1 K/DS
IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
IPP Rev:G 06.12.08 per ECN 886 EC
IPP Rev:H 07-04-30 As per Rev D JLM

Start Qty: 1.00

Required Qty: 1.00

D3189-1 Manufactured No 230 Each 34.0000 2.0000



Chafing Shield



<u>Warehouse</u>	<u>Loc Qty</u>	<u>Loc Code</u>
<u>Location</u>		
OFFSHORE		
FG	2	
36065	2	
Main Warehouse		
LG	32	
52446	12	
56353	20	

D3595-063-570 Manufactured No 230 Each 31.0000 4.0000



RUBBER CUSHION



<u>Warehouse</u>	<u>Loc Qty</u>	<u>Loc Code</u>
<u>Location</u>		
OFFSHORE		
FG	4	
37971	4	
Main Warehouse		
LG	27	
45509	27	

Thursday, April 08, 2010 8:19:42 AM

Shop Packet Print

Page 2

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Thursday, April 08, 2010 8:19:42 AM

Page 3

Work Order ID: 57531



Parent Item: D412-664-203



Parent Item Name: Crosstube Aft

Start Date: 4/9/2010

Required Date: 4/30/2010

Comments: IPP Rev:E 04.02.16 Reformat; Added D3189-1 K/DS
IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
IPP Rev:G 06.12.08 per ECN 886 EC
IPP Rev:H 07-04-30 As per Rev D JLM

Start Qty: 1.00

Required Qty: 1.00

MS21920-28

Purchased No

230

Each

99.0000

4.0000



Clamp(per MIL-DTL-8783C)

Warehouse

Loc Qty

Loc Code

Location

OFFSHORE

FG

5

105884

5

Main Warehouse

LG

94

112624

2

112863

50

113776

42

MS21920-30

Purchased No

230

Each

132.0000

2.0000



clamp(per MIL-DTL-8783C)

Warehouse

Loc Qty

Loc Code

Location

Main Warehouse

LG

132

109181

36

111258

50

112772

46

Thursday, April 08, 2010 8:19:42 AM

Shop Packet Print

Page 3

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Thursday, April 08, 2010 8:19:42 AM

Page 4

Work Order ID: 57531



Parent Item: D412-664-203



Parent Item Name: Crosstube Aft

Start Date: 4/9/2010

Required Date: 4/30/2010

Comments: IPP Rev:E 04.02.16 Reformat; Added D3189-1 K/DS
IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
IPP Rev:G 06.12.08 per ECN 886 EC
IPP Rev:H 07-04-30 As per Rev D JLM

Start Qty: 1.00

Required Qty: 1.00

AN6-40A Purchased No 250 Each 85.0000 4.0000



Bolt

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST343 85

112828 50

113422 35

AN6-41A Purchased No 250 Each 84.0000 2.0000



Bolt

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST344 84

112489 9

112805 25

113288 50

AN960JD616 Purchased No 250 Each 157.0000 18.0000



Washer

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST347 157

113149 157

Thursday, April 08, 2010 8:19:42 AM

Shop Packet Print

Page 4

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Thursday, April 08, 2010 8:19:42 AM

Page 5

Work Order ID: 57531



Parent Item: D412-664-203



Parent Item Name: Crosstube Aft

Start Date: 4/9/2010

Required Date: 4/30/2010

Comments: IPP Rev:E 04.02.16 Reformat; Added D3189-1 K/DS
IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
IPP Rev:G 06.12.08 per ECN 886 EC
IPP Rev:H 07-04-30 As per Rev D JLM

Start Qty: 1.00

Required Qty: 1.00

MS21042L6

Purchased No

250

Each

281.0000 6.0000



Nut

Warehouse

Loc Qty

Loc Code

Location

Main Warehouse

ST300

281

111578

281

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order: 5753
Description: Crosstube High Aft (412)		Part Number: D412-664-203
Inspection Dwg: D412-664-243 Rev: E		Page 1 of 1

Required Dimension	Min	Max
Height	24.24	24.50
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70

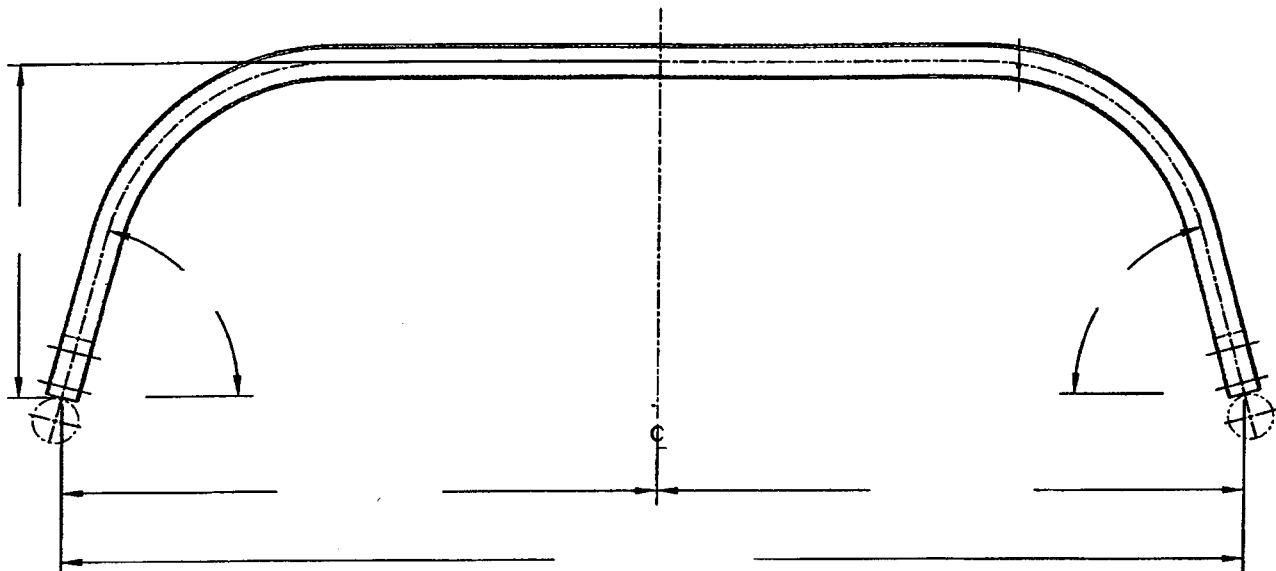

Comments

QC15 Inspection	
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. D	KJ/JLM	
C	10.02.02	Dwg Rev updated	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	App QC Insp

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -243	Part Number	Description
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 47.0 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 15) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

#57531

RELEASED
2009-10-29

E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 06-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058. CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087. ADD D2732-058 & MAGNOBOND 6398. MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. E
MFG. APPR.	PH	D412-664-243	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

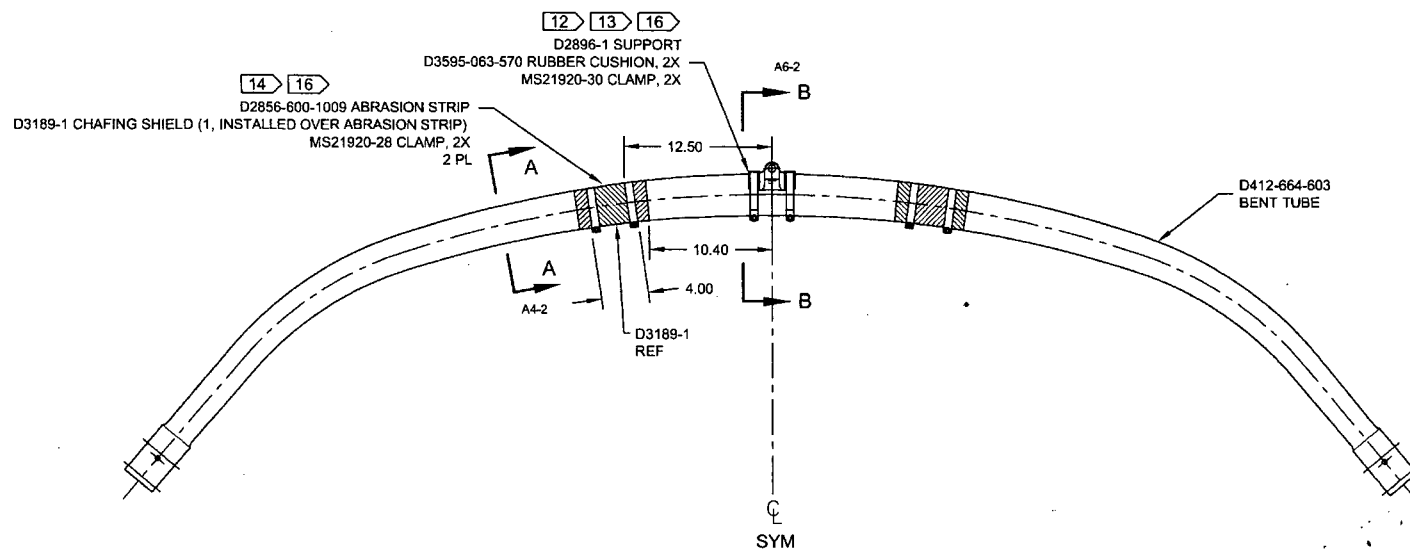


D212-664-243
ASSEMBLY DETAIL



#57531

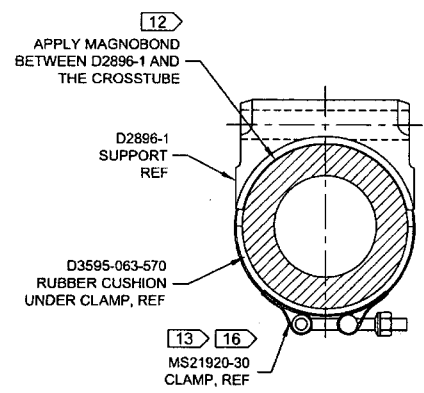

SECTION B-B D4-2
SCALE 4X

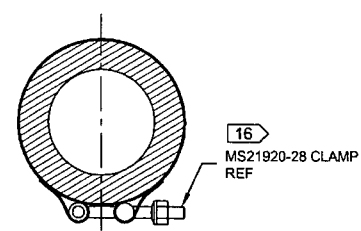

SECTION A-A C6-2
SCALE 4X

RELEASED
2009-10-29
NRP

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PS	DRAWING NO.	REV. E
MFG. APPR.	PS	D412-664-243	SHEET 2 OF 4
APPROVED	PS	TITLE	SCALE
DE APPR.	PS	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

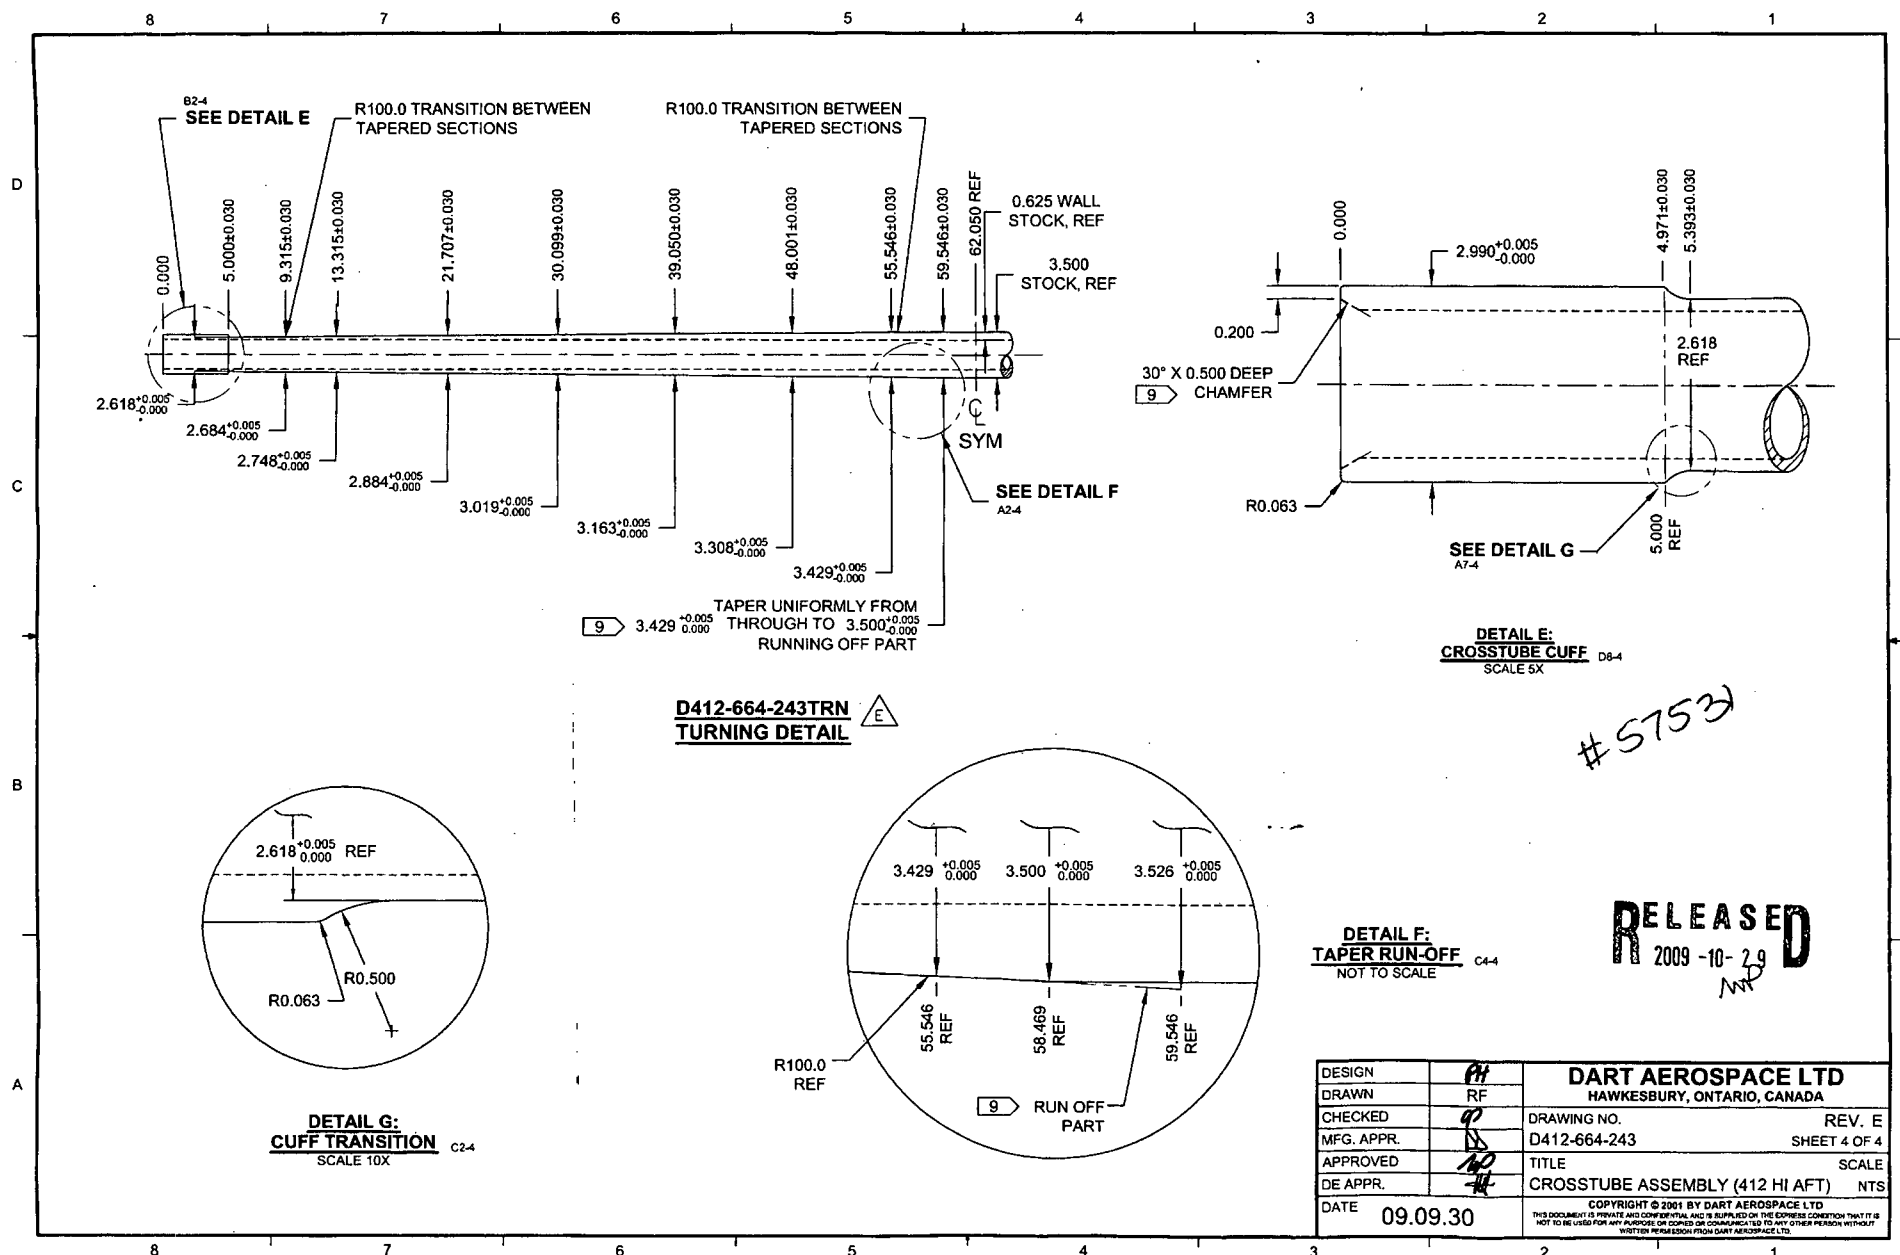

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:			WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP		Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
				Initial Chief Eng	Action Description Chief Eng	Sign & Date			

& initial all entries